













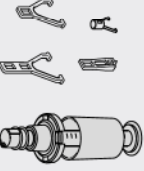















1.6 Geberit AP-Spülkästen

	110.000 (bis 1975)		120.000 (1975-1984) 120.000 (1985-1991)		125.920/923 (1976-1983)		127.000 (1983-1984) 127.000 (ab 1985)		123.000 (1992-1994)		124.000 (1990-1995)		130.000 (1994-1997)		140.300 (ab 1997)		140.000 (ab 2001)
	Monolith	Für die Renovierung empfehlen wir das Geberit Monolith Sanitärmodul für das WC Weitere Informationen finden Sie im aktuellen Geberit Verkaufsprogramm															
	Deckel	-	-	-	-	215.430.11.1	240.151.11.1	-	240.099.11.1	240.425.xx.1	240.947.xx.1	-	-	-	-	-	-
	Feder	-	-	-	-	813.514.00.1	-	-	-	313.514.00.1	-	-	-	-	-	-	-
	Betätigungshebel Wasserspartaste	-	215.362.00.1	215.362.00.1	215.362.00.1	-	-	-	-	-	-	-	-	-	-	-	-
	Ventilträger / Konsole	-	-	-	-	-	889.853.00.1	-	-	240.426.00.1	240.948.00.1	-	-	-	-	-	-
	Ersatzheberglocke	240.113.00.1	-	-	-	240.113.00.1	-	-	390.095.00.1	240.428.00.1	240.950.00.1	-	-	-	-	-	-
	Bügelset für Heberglocke	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	-	-	-	241.167.00.1	-	-	-	241.167.00.1	-	-	-
	Heberglockendichtung bis 1974 (Ø 63x23) ab 1975 (Ø 63x32)	891.015.00.1 816.418.00.1	- 816.418.00.1	816.179.00.1 (Ø 58x32)	816.179.00.1 (Ø 58x32)	816.418.00.1	816.418.00.1	816.418.00.1	-	816.418.00.1	816.418.00.1	816.418.00.1	816.418.00.1	-	-	-	-

	Ersatzfüllventil Unifill	240.700.00.1 oder 243.136.00.1	240.700.00.1 & 240.711.00.1 oder 243.136.00.1	-	240.700.00.1 oder 243.136.00.1	240.700.00.1 oder 243.136.00.1	240.700.00.1 oder 243.136.00.1	240.700.00.1 oder 243.136.00.1
	Dichtungsset zu Füllventil Unifill	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1
	Verbindungsschlauch	-	-	-	240.138.00.1	240.138.00.1	-	-
	Überwurfmutter für Spülrohr	238.073.11.1	238.073.11.1	238.073.11.1	-	-	240.431.11.1	240.431.11.1
	Quetschdichtung und Schleifring	258.236.00.1	258.236.00.1	258.236.00.1	-	-	258.236.00.1	258.236.00.1
	Bassin (Austausch)	215.026.11.1	215.026.11.1	-	215.026.11.1	-	240.429.00.1	240.429.00.1
	Befestigungsmaterial / Spülkastenaufhängung	294.825.00.1	294.825.00.1	294.825.00.1	294.825.00.1	-	240.430.00.1	240.430.00.1
	Eckventil	215.085.21.1	215.085.21.1	215.085.21.1	215.085.21.1	-	215.085.21.1	-
	Kippdichtung mit Sicherungsring	-	-	-	240.139.00.1	240.139.00.1	-	-
	Servicepaket	288.585.21.1	288.585.21.1	288.585.21.1	288.585.21.1	-	216.732.00.1	216.732.00.1
	Stauersatz	217.807.00.1	217.807.00.1	-	217.807.00.1	-	240.344.00.1	240.344.00.1